





## Aviation Service Inc.

Registration Number

**Serial Number** 

**Total Time** 

Date

Date

N706GS

2842391

**Tach 187.2 hrs** 

8/13/2

/26/2014

ith current

1.1. CW 100 hr / Annual inspection. C/A Completed 100 hr / Annual inspection I/A/W Piper PA-28-16 checklist.

LCW AD76-07-12R1 Ignition switch check. C/A C/W AD 76-07-12R1 no defects found.

LET inspection due per FAR 91.207(d). C/A C/W ELT inspection per FAR 91.207(d) battery due replacement 6/2020.

4 Rudder cable tension low. C/A Adjusted cable tension.

<sup>5</sup> Vertical fin strobe removed for use on N5323X


i. Monthly portable fire extinguishers check due. C/W weight and visual inspection.

The aircraft and/or component identified above was repaired and inspected in accordance with FAA regulations and was found airworthy for return to service. Pertinent details of the repair are

pair agency under Work Order # 023743 Dated 8/13/2014

**Certificate CRS BIOR473C** 

ervice Inc. 50 N. Airport Drive. Buffalo NY 14225

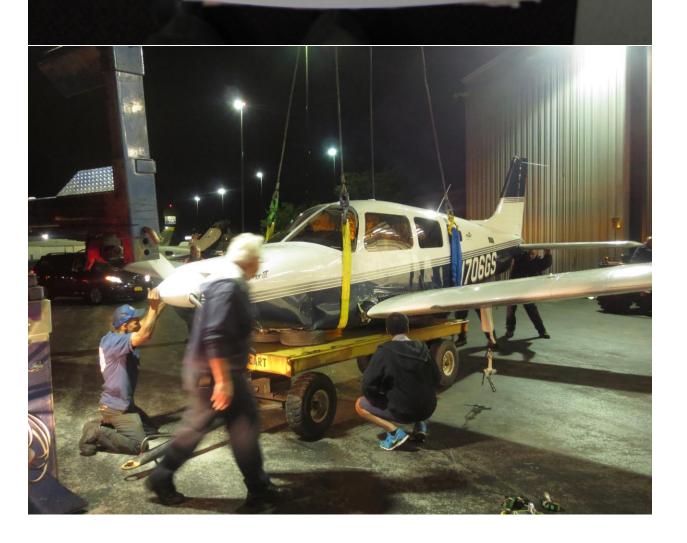

## AIRCRAFT DESCRIPTION Registration No. N706GS Model: PA-28-161 Popular Name: WARRIOR III Type Certificate No.: 2A13 Serial No.: 2842391 Colors: BRIGHT WHITE DARK SAPPHIRE BLUE MET. & CUMULUS GRAY MET. Engine Manufacturer: LYCOMING Serial Numbers: Single L-20559-39E Original Engine Model: 0-320-D3G Right\_ Propeller Manufacturer: SENSENICH Hub or Serial Number: Single A 62982 Original Propeller Model: 74 DM6-0-60 Left\_ Right\_ Blade Numbers Right Left 2013 MODEL and Remarks Aviation Service Inc **Total Time** Serial Number Registration Number Tach 187.2 hrs 8/13/2014 2842391 N706GS Engine TSN 187.2 hrs S/N L-20559-39E Engine 0-320-D3G 1,100 hr/ Annual inspection due. C/A C/W 100 hr / Annual inspection. Date 2. Hot cylinder compression check due. C/A C/W Hot compression check # 1 78/80, # 2 77/80, # 3 77/80 //16/2014 C 20W-50. and # 4 78/80. 3.0 II change due. C/A Inspected oil filter, installed new CH48110-1 filter and 8 qts of Phillips XC 20W-50. current The aircraft and/or component identified above was repaired and inspected in accordance with current FAA regulations and was found airworthy for return to service. Pertinent details of the repair are on file at this repair agency under Work Order # 023743 Dated 8/13/2014 Signed For Prior Aviation Service Inc. Certificate No. BIOR473C 50 N. Airport Drive. Buffalo NY







